


MATERIAL LIST

STOCK #	QTY.	DESCRIPTION
45-2164	1.0	TEE TAP PLEXCO 2" X 3/4" PE3408 BUTT FUSION
45-0152	1.0	CAP 3/4" PE3408 BUTT FUSION
45-0168	1.0	CAP 2" IPS BUTT FUSION PE3408
45-1899	1.0	RISER GAS 3/4"
43-0040	1.0	COCK GAS METER 3/4"
47-0020	1.0	ANODE MAGNESIUM 3 LB. WITH COVERING
19-1670	1.0	CONN SPLIT/BOLT COPPER MAX #10 STR

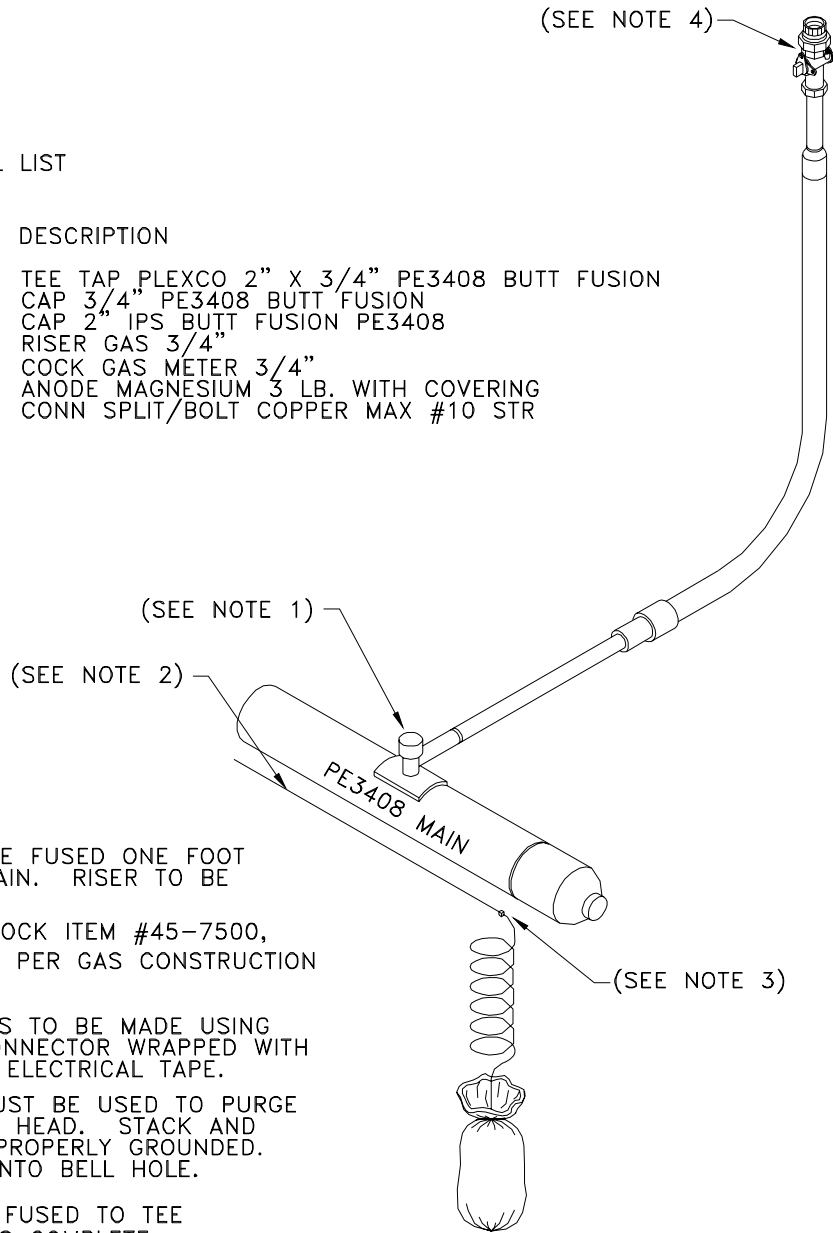

NOTES:

- 1) PURGE TEE TO BE FUSED ONE FOOT FROM END OF MAIN. RISER TO BE FUSED TO TEE.
- 2) TRACER WIRE, STOCK ITEM #45-7500, TO BE INSTALLED PER GAS CONSTRUCTION SPECIFICATIONS.
- 3) ALL WIRE SPLICES TO BE MADE USING A SPLIT BOLT CONNECTOR WRAPPED WITH AQUA-SEAL AND ELECTRICAL TAPE.
- 4) PURGE STACK MUST BE USED TO PURGE ABOVE WORKER'S HEAD. STACK AND RISER MUST BE PROPERLY GROUNDED. DO NOT PURGE INTO BELL HOLE.
- 5) END CAP TO BE FUSED TO TEE AFTER PURGING IS COMPLETE, THEN SOAP TESTED UNDER OPERATING PRESSURE. LEAVE SERVICE TEE VALVE IN THE CLOSED POSITION.



ENGINEERING & CONSTRUCTION STANDARD

SECTION 5 GAS CONSTRUCTION DRAWINGS  
DISTRIBUTION CAP INSTALLATIONS  
2" CAP PE WITH PURGE TEE

SHEET 3 OF 13

DRAWING NUMBER

DCI02G

DRAWN	DESIGN	SUPR	DATE	REV
GD	KS	HB	5/98	7/06