


MATERIAL LIST

STOCK #	QTY.	DESCRIPTION
45-2168	1.0	TEE TAP PLEXCO 4" X 3/4" PE3408 BUTT FUSION
45-0152	1.0	CAP 3/4" PE3408 BUTT FUSION
45-0186	1.0	CAP 4" IPS BUTT FUSION PE3408
45-1899	1.0	RISER GAS 3/4"
43-0040	1.0	COCK GAS METER 3/4"
47-0020	1.0	ANODE MAGNESIUM 3 LB. WITH COVERING
19-1670	1.0	CONN SPLIT/BOLT COPPER MAX #10 STR

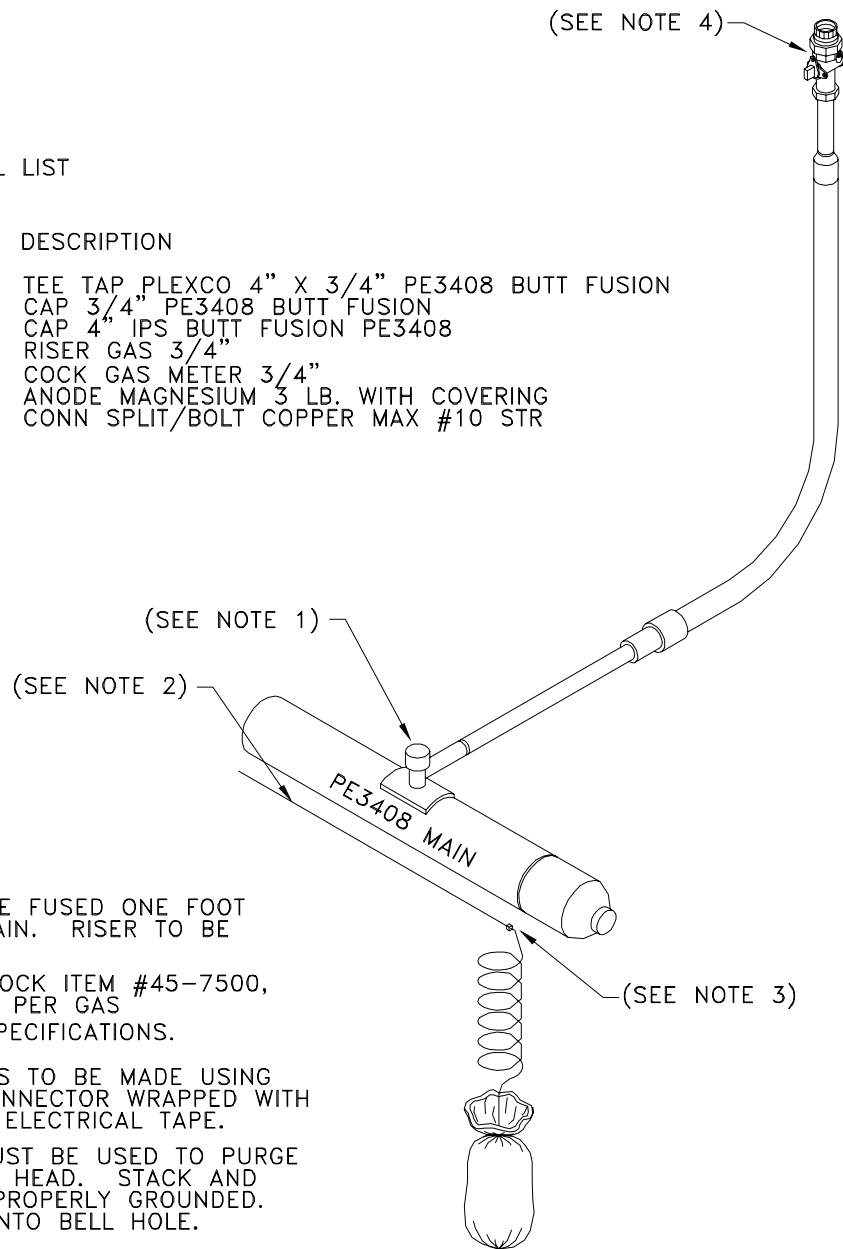

NOTES:

- 1) PURGE TEE TO BE FUSED ONE FOOT FROM END OF MAIN. RISER TO BE FUSED TO TEE.
- 2) TRACER WIRE, STOCK ITEM #45-7500, TO BE INSTALLED PER GAS CONSTRUCTION SPECIFICATIONS.
- 3) ALL WIRE SPLICES TO BE MADE USING A SPLIT BOLT CONNECTOR WRAPPED WITH AQUA-SEAL AND ELECTRICAL TAPE.
- 4) PURGE STACK MUST BE USED TO PURGE ABOVE WORKER'S HEAD. STACK AND RISER MUST BE PROPERLY GROUNDED. DO NOT PURGE INTO BELL HOLE.
- 5) END CAP TO BE FUSED TO TEE AFTER PURGING IS COMPLETE, THEN SOAP TESTED UNDER OPERATING PRESSURE. LEAVE SERVICE TEE VALVE IN THE CLOSED POSITION.

DRAWN	DESIGN	SUPR	DATE	REV
GD	KS	HB	5/98	7/06